


## **BX1829 Installation Instructions** 2002 Nissan Altima 2004 Nissan Maxima 3/5SL

Serial No.

The front fascia and tie down brackets are removed for baseplate installation. Tie down brackets will not be reinstalled. No drilling necessary. The BX8869 is available for the vehicle. Attachment Tabs are 22 inches center to center and a height of 15 5/8 inches.

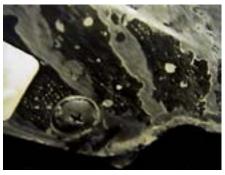

1. Remove two phillips screws from under fascia corner, just forward of front tire, both sides.



3. Just forward of front tires, inside fender, on fascia corner are two metric bolts to remove with the 10MM Socket, both sides.



**5.** Using the 10MM socket, remove the three metric bolts from the windshield washer reservoir, unplug electrical, plug water lines in reservoir or drain tank, and set aside.



2. Remove five push pins from bottom of fascia.



4. Remove six push pins from the top side of fascia, pull fascia forward, and set aside.



6. Remove two metric bolts from air intake damper on driver's side with 10MM socket and set aside.






7. Using the 14MM socket, remove the three metric bolts from tie down bracket, both sides, and set aside. Tie down brackets will not be reinstalled. Remove temperature sensor from the bottom of metal bumper and tie up out of the way.



9. Hold baseplate to align with existing tie down bracket holes. Fasten items 4 and 5, both sides, and tighten. On driver's side, reinstall air intake damper with existing back bolt and item 3 for the front bolt (use existing bushing with item 3) Be sure and use loctite on all bolts before tightening.



8. Cut webbing just below bolt, on frame end, with the hack saw and bend webbing forward to relieve area for baseplate, as shown in photo. Remove metric bolt with the 10MM socket, both sides, and replace after baseplate is installed.

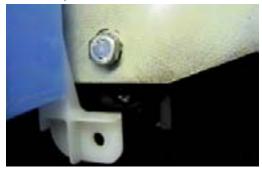

10. Reinstall windshield washer reservoir. Reconnect hoses and electrical plugs. Install items 2, 6, 7, and 8, that will replace the lower front bolt and support. Be sure and use loctite on all bolts before tightening.

- 11. Reinstall the temperature sensor, bolts in step 7, and fascia.
- 12. The dimensional variations between otherwise identical cars can be considerable. While the location and size of the holes in the baseplate were designed to allow for easy installation, it may be necessary to file a hole slightly to allow a bolt to clear.
- 13. Install the tow bar and safety cables according to the instructions included in their packages.
- **14.** Do **not** substitute other devices if the tow bar pin and clip are lost.
- 15. DEALER OR INSTALLER: BE CERTAIN THE USER RECEIVES THE INSTRUCTION SHEET.








10MM SocketLoctite BlueUtility Knife12MM Socket17MM SocketVise Grips14MM SocketPhillips Screw DriverHack Saw

## **Parts List**


Ref. No.	Qty.	Part No.	Description
1	1	61-5775	
2	1	102-6267	Flat, 1/8 X 1 X 4 1/8
3	1	201-0702	
4	6	201-0423	
5	6	203-0104	10MM Lock Washer, ZP
6	1	201-0071	1/4-20 x1 Bolt, Grd. 5, ZP
7	1	203-0001	1/4 Flat Washer, ZP
8	1	202-0069	Hex Nut, Whiz Loc, ZP
9	2		#12-14 X 1" Self Drilling Screw, ZP
10	2	201-0192	#10-32 x 1/2 Slot, Rd. Hd. Screw
11	2	203-0054	#10 Lock Washer
12	2	202-0047	#10-32 Hex Nut
13	2	101-5822	Adapter, 4 Way Connector





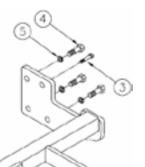

Locations for the BX8869.

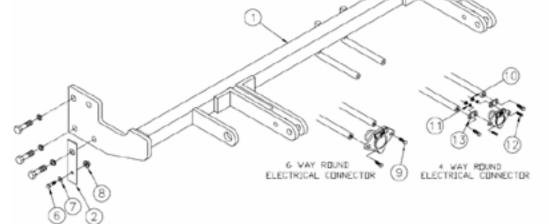

**IMPORTANT:** Use only genuine factory replacement parts on your Base Plate. Do not substitute homemade or nontypical parts. If a bolt is lost or in need of replacement, for your safety and the preservation of your Base Plate, be sure to use a replacement bolt of the same grade (Usually Grade 5, refer to parts list). Repair parts may be ordered through your nearest **Blue Ox** dealer or distributor.

